

# Murray Darling Basin – water quality and dissolved oxygen results

---

Multiple agencies are undertaking water quality monitoring to review dissolved oxygen conditions across NSW, identify potential risks to ecological communities, implement mitigating measures and respond to the mass fish death event in the Darling River. This update provides a summary of information collected up to 28 May 2023.

---

As air and water temperatures decrease, dissolved oxygen in rivers and streams across the majority of New South Wales are at safe levels for fish health. The only remaining area of concern for fish deaths is the Darling River between the Lake Wetherell Main Weir and the junction of the Darling River at Menindee Creek, downstream of Menindee township.

To maintain an oxygenated flow in the Darling River through Menindee township, the release of water from the Lake Pamamaroo outlet is continuing, although volumes have been reduced to preserve the water resource in the upper lakes. Releases from Lake Menindee have also been reduced to assist in the flow of water from Lake Pamamaroo past Menindee town. Monitoring is showing that the adjusted releases are having a positive effect on dissolved oxygen levels (that is, they remain above critical levels) in the Darling River at Menindee.

There remains a risk of further fish deaths in the Darling River at Menindee as fish in an already stressed condition may succumb to increased competition for depleting food resources and cooler temperatures. This is particularly the case for Bony Herring, which boomed during the recent floods, and many may now be in poor condition and are more susceptible to environmental stresses like cold water temperatures. There are still large numbers of Bony Herring in the reach of Darling River downstream of Lake Pamamaroo.

To report any further incidents of dead fish, fish struggling or starting to gasp at the water surface, or crayfish exiting the water, please call the NSW Department of Primary Industries Fisheries' Fishers Watch Phonenumber 1800 043 536 or fill in a fish kill protocol and report form at: [www.dpi.nsw.gov.au/fishing/habitat/threats/fish-kills-2019-2020/info-sheet](http://www.dpi.nsw.gov.au/fishing/habitat/threats/fish-kills-2019-2020/info-sheet)

## Dissolved oxygen levels – Darling River at Menindee

Monitoring undertaken in Menindee Lakes on 22 and 23 May highlights that the water being released from lakes Pamamaroo and Menindee is oxygenated and above the safe threshold for fish health. Releases from both Lake Pamamaroo and Lake Menindee continue to be managed to minimise the risk of further hypoxia-related fish deaths.

Figure 1 is a Google Earth image showing the location and results from the survey of dissolved oxygen levels down the Darling River on 25 May from Lake Pamamaroo, through Menindee town and down past the junction with the inflow from Lake Menindee. The results show that there was a gradual decrease in oxygen levels with distance down the Darling River. The lowest results were at Menindee township (6.39 mg/L) and immediately upstream of the Darling River-Menindee Creek junction (4.88 mg/L). Dissolved oxygen levels improve again following dilution by the oxygenated water being released from Lake Menindee. As a general guide, native fish and other large aquatic organisms require at least 2 mg/L of dissolved oxygen to survive but may begin to suffer if levels are below 4 to 5 mg/L for prolonged periods.



Figure 1: Google Earth image showing dissolved oxygen results (mg/L) from the Lake Pamamaroo outlet to Menindee Creek on 25 May 2023.

Frequent longitudinal surveys of dissolved oxygen have been undertaken by WaterNSW down this reach of the Darling River over recent months. Figure 2 shows that dissolved oxygen levels have been improving since the initial profile undertaken on 25 March. Dissolved oxygen levels increased through April, but were still below the critical threshold for fish health of 4 mg/L in the vicinity of Menindee town. The most recent survey undertaken on 25 May shows oxygen levels are remaining above 4 mg/L in response to the operational measures in place.

Recent monitoring of the Menindee System shows improved levels of dissolved oxygen in all lakes.

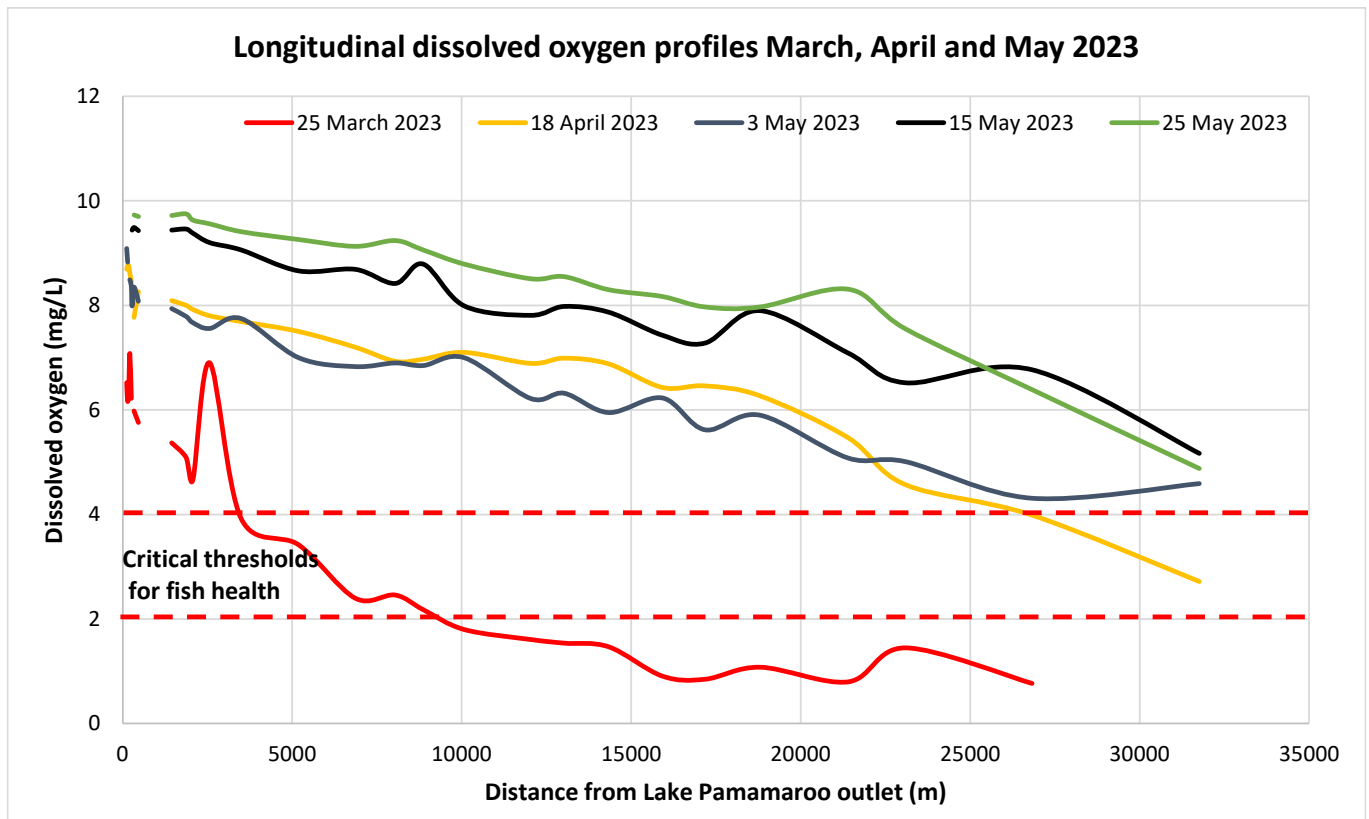


Figure 2: Comparison of dissolved oxygen results (mg/L) from the Lake Pamamaroo outlet to Menindee town on 25 March, 18 April and 3, 15 and 25 May 2023

Data from WaterNSW dissolved oxygen sensors at the Menindee pump station, Menindee Town, and further downstream at Weir 32, are shown in Figure 3. These sensors are set at various depths so may not always reflect the readings taken at the water surface. Dissolved oxygen levels at the two sites near Menindee have been fluctuating from day to day over the past week but are remaining above the fish health threshold of 4 mg/L. The readings from Weir 32 show the water is oxygenated and is also providing a refuge area for fish to move into if required.

NSW and Commonwealth agencies will continue to work together and monitor dissolved oxygen levels in this area and advise the best operational measures to mitigate risks to aquatic life as much as possible. This can involve adjusting the timing, size and location of releases from the lakes into the lower Darling River to maintain the quality of the water in the river.

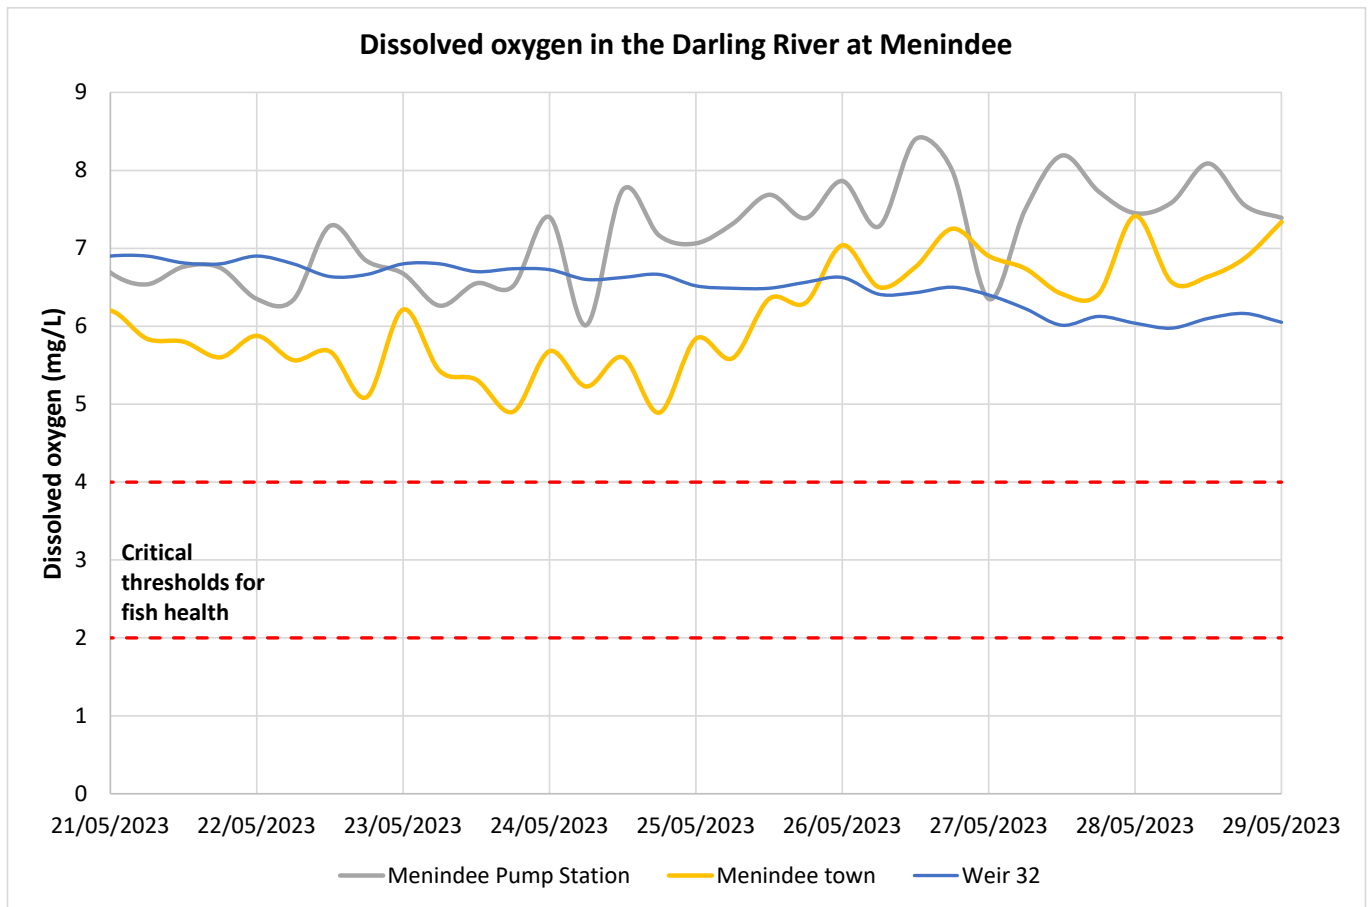


Figure 3: Dissolved oxygen (mg/L) in the Darling River at Menindee: Menindee pump station, Menindee town and Weir 32 – 21 to 29 May 2023

### Hypoxic blackwater fish death summary

In the past 8 months, NSW DPI Fisheries has received reports of fish deaths, fish struggling and crustaceans leaving the water across a broad area in the Murray-Darling Basin, including in the Darling, Murray, Kolety/Edward, Wakool, Murrumbidgee, Lachlan, Gwydir, Barwon, Namoi and Macquarie rivers and Yanco-Billabong Creek system.

There was a report on Friday 26 May of a small fish death incident in Merrimajeel Creek downstream of Merrimajeel Regulator (Lachlan Valley), with hundreds of dead Carp observed. It is likely these Carp were stranded and died when water levels fell to a very low level. When water levels rose again, the dead Carp then floated to the surface and were observed.

There have not been any new reports of fish deaths in the Darling River near Menindee during the past week to 28 May. There remains a risk of further fish deaths in this area as fish (particularly Bony Herring) may be in poor condition from previous low oxygen conditions, and may be more susceptible as temperatures decrease and flow rates recede.

### What is being done?

Emergency releases of oxygenated water from the Menindee Lakes are continuing. This is to maintain flow between Lake Pamamaroo outlet and Weir 32 with the aim of reducing the risk of

further fish deaths. These releases are gradually being reduced to preserve the water resource in the upper lakes. This water is being debited from environmental water accounts. Ongoing dissolved oxygen monitoring will identify if the operations continue to achieve the desired result of improved dissolved oxygen levels, and will be used to inform future operational decisions.

Programs to benefit native fish, such as improving fish passage and habitat restoration to provide conditions conducive to fish breeding and population growth, are ongoing. These works are vital and provide an environment where fish populations can bounce back from low oxygen events.

### Blue-green algae

WaterNSW undertake routine blue green algae monitoring in Menindee Lakes and in the Darling River. Alert warnings are declared where algal cell numbers exceed the triggers identified in the Guidelines for Managing Risk in Recreational Waters (2008).

The most recent results indicate red alert warnings for recreational use in Talyawalka Creek at the Menindee-Pooncarie Road and Darling River at Tolarno, with algal numbers at most sites in the Menindee Lakes area remaining in the amber alert range for recreational use ([Algae Alerts NSW map - WaterNSW](#)). When a red alert warning is in place, people should avoid recreational activities that brings them into contact with the water and drinking untreated water. At the amber alert warning level, blue-green algae may be multiplying in numbers but remains suitable for recreational use. The water may have a green tinge and musty or organic odour.

The water should be considered unsuitable for potable use and alternative supplies or prior treatment of raw water for domestic purposes should be considered. The water may also be unsuitable for stock watering. Water users should use caution and avoid water where signs of blue-green algae are present.

### Weather outlook

Refer to the [Bureau of Meteorology website](#) for the latest forecasts.

### Additional information

To notify the NSW Department of Planning and Environment – Water of potential blackwater events email: [waterqualitydata@dpie.nsw.gov.au](mailto:waterqualitydata@dpie.nsw.gov.au)

To report dead fish, fish struggling or gasping at the water surface, or crayfish leaving the water please call the NSW DPI Fisheries Phoneline 1800 043 536 or fill in a fish kill protocol and report form at: <https://www.dpi.nsw.gov.au/fishing/habitat/threats/fish-kills-2019-2020/info-sheet>

Information on recent fish deaths is available at: [Fish kills in NSW](#). When reporting, please include the name of the river/waterbody, location and date of your observation. If possible, please also record what species are affected and an estimate of number of each species observed.

Further information on blackwater events can be found at the DPE Water website at: [www.industry.nsw.gov.au/water/allocations-availability/droughts-floods/drought-update/managing-drought-recovery/blackwater](http://www.industry.nsw.gov.au/water/allocations-availability/droughts-floods/drought-update/managing-drought-recovery/blackwater)

Additional information is also available on the Murray-Darling Basin Authority website at:  
[www.mdba.gov.au/publications/mdba-reports/water-management-101-factsheets](http://www.mdba.gov.au/publications/mdba-reports/water-management-101-factsheets)

Operational updates are available at: [WaterInsights - WaterNSW](#)

Flood updates can be found on the Environment Protection Authority web page at:  
[www.epa.nsw.gov.au/news/news/2022/nsw-storm-and-flood-updates-2022](http://www.epa.nsw.gov.au/news/news/2022/nsw-storm-and-flood-updates-2022)

To report suspected algal blooms, see the [WaterNSW website](#).